### **BARRON COUNTY HIGHWAY DEPARTMENT**

#### **TRUCKS FOR SALE**

### \$65,000 MINIMUM BID

# #67 PETERBILT DUMP PATROL TRUCK, 41000 GVW

**CURRENT MILEAGE: 123317** 

Includes sander (#367), underbody blade (#567B), front plow (#567P), and wing (#567W)

Manufacturer: PETERBILT

Model: 335 Year: 2005

Purchased From: PETERBILT

Date Delivered: 11/16/2004

Serial Num (VIN): 2NPLHZ8X95M862745

Body: PETERBILT

Engine: CUMMINS, DIESEL, ISC315 Transmission: ALLISON, MD3066P

Front Wheels: 315/80R22.5 Rear Wheels: 11R22.5

BCHD Fleet #	Year	Make	Model	Description	Miscellaneous Information
67	2005	Peterbilt	MATE AND DESIGNA		Minimum Bid of \$65,000 123,317 miles
					See Jerry Pich for service questions















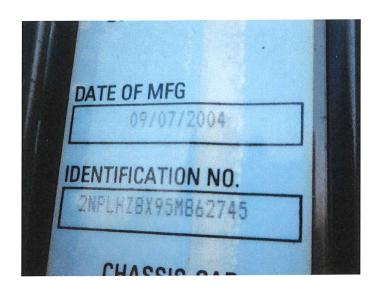



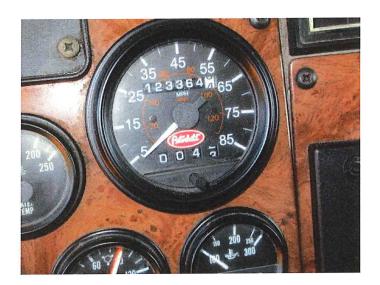



#### **REPAIR NOTES FOR TRUCK #67**

ILI AIN NO	ES FOR TRUCK #67				
<u>Date</u>	<u>Notes</u>				
12/02/2013	REPLACE PLUG ON LIQUID TANK				
12/17/2013	REPLACE AUGER BEARING - FIX WING PINS AND MAKE BUSHING - MAKE STOP FOR UNDERBODY				
01/03/2014	REPAIR SPRING ASSY - REPAIR ENGINE FAN - FREE UP BRAKE PEDAL				
01/02/2014	DIAGNOSE BRAKE ISSUE				
	INVESTIGATE ELECTRICAL PROBLEM				
	FINAL DETAIL				
	RESEARCH FAN TROUBLES TROUBLESHOOT FAN PROBLEM - SWAP BLOWER MOTOR ASSY - NEEDS NEW FAN				
	INSTALL OIL PAN				
	CHANGE FUEL FILTERS				
	INSTALL NEW ECM				
· · · · · · · · · · · · · · · · · · ·	FINISH INSTALLING NEW ECM - HOOKUP LINES - FILL WITH COOLANT				
	TAP STARTER TO GET STARTED, REPAIR WIRING IN BATTERY BOX				
	INSTALL AC BOLT/FAN, REMOVE SPRING/SHACKLE BUSHINGS & PINS, INSTALL FRONT BUSHINGS				
	INSTALL PINS FOR SHACKLES, FIX LEAK FOR LF SPINNER, CLEAN OUT HEATER CORE				
05/28/2014	INSTALL AC COMPRESSOR. REMOVE FAN TO INSTALL BELT, INSTALL LOWER MOTOR MOUNT/CLAMP				
06/04/2014	CHARGE AC, ADD OIL TO PUMP, REMOVE AND REPLACE REAR SHOCKS, TIGHTEN LF LIGHT HOLDER RIGHT REAR ON BOX,				
*	REPLACE STROBE RR, REPLACE WING SPRING BOLT, CLEAN CHASSIS, CLEAN BATTERIES				
07/08/2014	FILL OIL, CHECK LEAKS, CHANGE OIL FILTER				
08/14/2014	ANNUAL - FINISH PEDALS, FINISH KEYING & PINS, PULL WING STRUT FOR REPAIR, REPIN SANDER GATE, REPAIR OPEN LIQUID				
	TANK WIRES, STRAIGHTEN SPINNER PAN				
08/13/2014	REPLACE THROTTLE & BRAKE & CLEAN & INSTALL THROTTLE, START TO REPIN, FREE UP & LUBE HOIST ARMS ANNUAL - REPLACE HOSES, REFASTEN L TO R SPINNER, TIE UP & INSULATE HOSES, CHARGE BATTERIES, REPLACE BROKEN				
	MIRROR BRACKET  ANNUAL - REPLACE & REROUTE HOSES, INSTALL REPAIRED WING BRACE, REPLACE UP PIVOT BOLTS, CLEAN/PRIME/PAINT				
	LOWER HYD TANK				
	ADJUST BRAKES, PINION SEAL RUSTED OUT				
	GET STROBE LIGHTS WORKING				
11/20/2014	FIND BRAKE PROBLEM - REPLACE RIGHT REAR BRAKE & ADJUST CHANGE PINION SEAL, BEGIN WORK ON BRAKES/S-CAMS				
12/09/2014	REMOVE WHEELS, BRAKE DRUMS, SHOES & S-CAMS, CAMS ARE BAD - DRIVE OUT BUSHINGS, REMOVE SEALS FROM HUBS,				
12/10/2014	ICLEAN CONTACT AREA & ORDER PARTS				
12/17/2014	REMOVE EXHAUST MANIFOLD, FREE UP EXHAUST BRAKE, CHANGE ACTUATOR, GET READY FOR GASKETS, DIAGNOSE NOISE				
12/11/2014	BEGIN PUTTING BRAKES BACK TOGETHER				
	FINISH TURBO				
12/18/2014	MAKE EXHAUST, CHANGE DOT CLAMP, INSTALL MANIFOLD/TURBO AND EXHAUST BRAKE				
01/12/2015	REPLACE LF HUB CAP				
01/22/2015	REMOVE EXHAUST MANIFOLD, CLEAN HEAD WHERE MANIFOLD BOLTS TO IT, CARBON BUILT UP, HAD TO CHISEL OFF, START LIGHT ISSUES				
01/26/2015	CHANGE OIL				
01/23/2015	PUT EXHAUST MANIFOLD TOGETHER, CHECK FOR LEAKS, TURBO LEAKS BAD BETWEEN TURBO & ADAPTER PLATE, REPAIR WIRING TO LEFT FRONT PLOW LIGHT & RIGHT FENDER, CHANGE OIL & FILTER, LUBE, CHECK LUBE, LEVELS, ADJUST BRAKES				
01/27/2015	REMOVE TURBO, BROKEN BOLTS FROM ADAPTER, HOLE CRANKED ON TURBO, ORDER				
	INSTALL NEW TURBO				
02/05/2015	TEST DRIVE, REPLACE LF FT BRAKE CHAMBER, ADJUST FRONT BRAKES, REPLACE LEFT LOWER HEAD LAMP BULB PLUG & BULB				
02/06/2015	TEST DRIVE - REMOVE BRAKE PEDAL, COMPARE TO 78, MUCH DIFFERENT, REINSTALL BRAKE PEDAL				
04/29/2015	CLEAN SALT OUT AND DRAIN BRINE TANK, RINSE TRUCK				
06/17/2015	ANNUAL - FIX ENGINE OIL LEAK, FOUND STEERING ASSIST RAM LEAKING, FIX FLAPS ON TAILGATE, REATTACH FLUID VALVE, ATTACH RIGHT LIGHTS CABLES				
07/01/2015	START REMOVING SHOCKS				
06/25/2015	CHANGE POWER STEERING FILTER, AIR DRYER FILTER, INSTALL MOD DOOR MOTOR, PUT DASH BACK TOGETHER, START GREASE JOB, LOOK OVER HOSES				
06/29/2015	INSTALL PURGE VALVE, HEATER UNIT, REBUILD POWER STEERING ASSIST RAM AND REINSTALL				
	FAB PINS				
06/30/2015	GREASE, LOOK OVER, ORDER SHOCKS, TOP OFF POWER STEERING FLUID, LOOK FOR AIR LEAKS, FIX WIRE ON LEFT SIDE, AND REPLACE MARKER LIGHT ON LEFT LOWER				
	FINISH ANNUAL - CHECK BRAKES, LUBE LATCHES, LOOK OVER, REMOVE SHOCKS, CHECK TIRES, INSTALL SHOCKS				
07/30/2015	WASH, VACUUM				
	REPLACE GROUND CABLE TO STARTER, MAKE NEW CABLE, TEST ALTER, REPLACE ALT, RETEST, CHARGE BATTERIES, RUN ALT TO REBUILDERS				
09/17/2015	NEEDS BATTERY CABLE				
	REANNUAL - REPIN & KEY LIGHTS, FREE UP BRACES, REPLACE HOSES & TIE UP, INSULATE HOSES, WIRES				
11/10/2015	DRAIN, CLEAN OUT HYD TANK, REFILL, FILTERS & FILLERS SCREEN & CAP, REPLACE, SETUP BRAKES, WIPERS, LUBE SHAFT				

## **REPAIR NOTES FOR TRUCK #67**

12/28/2015 REPLACE BAD TEMP SENSOR 12/28/2015 REPLACE BAD TEMP SENSOR 12/28/2015 REPAIR AIR LEAK, LOOK FOR REASON BACKUP ALARM WAS THROWING FUSE, TAKE WIRE HARNESS APART LOOKING FOR ISSUE BUT FOUND NONE, TIE WIRES BACK UP 12/28/2015 CHECK CHARGING SYSTEM, HAS BLOWN FUSE, REMOVE DASH PANELS, SHORT IN TRANS HARNESS SOMEWHERE BETWEEN BUTTONS AND TRANS, DID SOME MORE TESTING, SHORT IN REVERSE CIRCUIT, DUMP LOAD, RIGHT REAR TAIL LIGHT IS OUT AND NO REVERSE ALARM 12/24/2015 ELECTRICAL PROB - COULDN'T DUPLICATE 10/104/2016 FIND OUT FUEL GAUGE PROBLEM, REPLACE FUSE, LOOK OVER WIRES, FIND PROBLEM WITH WIPER SWITCH GOING BAD 02/01/2016 CUT NEW CONDUIT AND WELD ON FOR STROBES 02/01/2016 HELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE 02/10/2016 OHANGE OIL 04/18/2016 SPINNER MOTOR, SEAL KIT 06/07/2016 SPINNER MOTOR, SEAL KIT 06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP 06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST 06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY 05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL 06/19/2016 REPLACE RT OUTER WHEEL 06/09/2016 REPLACE RT OUTER WHEEL 06/09/2016 REPLACE RT OUTER WHEEL 06/19/2016 RAND BLAST BOX, PRESSURE WASH SAND 06/19/2016 RAND BLAST	<u>Date</u>	<u>Notes</u>			
ISSUE BUT FOUND NONE, TIE WIRES BACK UP  12/23/2015 CHECK CHARGING SYSTEM, HAS BLOWN FUSE, REMOVE DASH PANELS, SHORT IN TRANS HARNESS SOMEWHERE BETWEEN BUTTONS AND TRANS, DID SOME MORE TESTING, SHORT IN REVERSE CIRCUIT, DUMP LOAD, RIGHT REAR TAIL LIGHT IS OUT AND NO REVERSE ALARM  12/24/2015 ELECTRICAL PROB - COULDN'T DUPLICATE  01/04/2016 FIND OUT FUEL GAUGE PROBLEM, REPLACE FUSE, LOOK OVER WIRES, FIND PROBLEM WITH WIPER SWITCH GOING BAD  02/01/2016 CUT NEW CONDUIT AND WELD ON FOR STROBES  02/01/2016 IELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE  02/16/2016 O4/18/2016 SPINNER MOTOR, SEAL KIT  06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP  06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST  06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCAPER IS IN THE WAY  05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  06/06/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASEMBLE THE CONTROL WHEEL  06/08/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASEMBLE THE CONTROL TOWER, LOCATE AND REPARTS, THERMOSTAT, BEGIN ANNUAL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASEMBLE THE CONTROL TOWER, LOCATE AND REPARTS, THERMOSTAT, BEGIN ANNUAL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPAIR AIR LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTO	12/01/2015				
BUTTONS AND TRANS, DID SOME MORE TESTING, SHORT IN REVERSE CIRCUIT, DUMP LOAD, RIGHT REAR TAIL LIGHT IS OUT AND NO REVERSE ALARM  12/24/2015 ELECTRICAL PROB - COULDN'T DUPLICATE  01/04/2016 FIND OUT FUEL GAUGE PROBLEM, REPLACE FUSE, LOOK OVER WIRES, FIND PROBLEM WITH WIPER SWITCH GOING BAD  02/01/2016 CUT NEW CONDUIT AND WELD ON FOR STROBES  02/16/2016 CHELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE  02/16/2016 CHANGE OIL  04/18/2016 SPINNER MOTOR, SEAL KIT  06/07/2016 FUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP  06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST  06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & RESPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL REAK A	12/28/2015	ISSUE BUT FOUND NONE, TIE WIRES BACK UP			
01/04/2016 FIND OUT FUEL GAUGE PROBLEM, REPLACE FUSE, LOOK OVER WIRES, FIND PROBLEM WITH WIPER SWITCH GOING BAD 02/01/2016 CUT NEW CONDUIT AND WELD ON FOR STROBES 02/10/2016 HELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE 02/16/2016 CHANGE OIL 04/18/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP 06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST 06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY 05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & SCOLANT, WORK ON REPLACING CABLE TO BOX CONTROL 05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL 06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER 06/09/2016 REPLACE RT OUTER WHEEL 06/08/2016 REPLACE RT OUTER WHEEL 06/14/2016 PRESSURE WASH AND SANDBLAST 06/2012/2016 PRESSURE WASH AND SANDBLAST 06/2012/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/2012/2016 PAINT FRAME, ENAMEL, SPRAY GUN	12/23/2015	BUTTONS AND TRANS, DID SOME MORE TESTING, SHORT IN REVERSE CIRCUIT, DUMP LOAD, RIGHT REAR TAIL LIGHT IS OUT			
02/01/2016 CUT NEW CONDUIT AND WELD ON FOR STROBES 02/01/2016 HELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE 02/16/2016 CHANGE OIL 04/18/2016 SPINNER MOTOR, SEAL KIT 06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP 06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST 06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY 05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL 05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL - REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER 06/09/2016 REPLACE ROUTER WHEEL 06/08/2016 REPLACE ROUTER WHEEL 06/08/2016 REPLACE ROUTER WHEEL 06/13/2016 PRESSURE WASH AND SANDBLAST 06/16/2016 AND BLAST BOX, PRESSURE WASH SAND 06/16/2016 AND BLAST BOX, PRESSURE WASH SAND 06/16/2016 SAND BLAST BOX, PRESSURE WASH SAND 06/16/2016 PRISST FRAME, ENAMEL, SPRAY GUN 06/202/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/202/2016 INSTALL LEFT LOWER MIRROR & BRACKET	12/24/2015	ELECTRICAL PROB - COULDN'T DUPLICATE			
02/01/2016 HELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE 02/16/2016 CHANGE OIL 04/18/2016 SPINNER MOTOR, SEAL KIT 06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP 06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST 06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY 05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL 05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL 06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER 06/08/2016 REPLACE RT OUTER WHEEL 06/14/2016 PRESSURE WASH AND SANDBLAST 06/16/2016 SAND BLAST BOX, PRESSURE WASH SAND 06/16/2016 PRESSURE WASH AND SANDBLAST 06/16/2016 PRESSURE WASH AND SANDBLAST 06/16/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN	01/04/2016	FIND OUT FUEL GAUGE PROBLEM, REPLACE FUSE, LOOK OVER WIRES, FIND PROBLEM WITH WIPER SWITCH GOING BAD			
02/16/2016 CHANGE OIL 04/18/2016 SPINNER MOTOR, SEAL KIT 06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP 06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST 06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY 05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL 05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL 06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER 06/08/2016 REPLACE RT OUTER WHEEL 06/14/2016 PRESSURE WASH AND SANDBLAST 06/14/2016 PRESSURE WASH AND SANDBLAST 06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT 06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/20/2016 INSTALL LEFT LOWER MIRROR & BRACKET	02/01/2016	CUT NEW CONDUIT AND WELD ON FOR STROBES			
04/18/2016 SPINNER MOTOR, SEAL KIT  06/07/2016 PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP  06/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST  06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  06/13/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  06/08/2016 REPLACE RT OUTER WHEEL  06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	02/01/2016	HELP MAK ON CONDUIT AND REWIRE LIGHT AND REPLACE PARTS ON LEFT UPPER STROBE			
D6/07/2016  PUT EXHAUST TOGETHER UNDER TORCH, FOUND ANOTHER LEAK, FILL OUT ANNUAL CHECK LIST, CHECK LIGHTS & REMOVE LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP  O6/06/2016  GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST  ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOY RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  O5/31/2016  ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  O6/26/2016  REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  O6/09/2016  REPLACE RT OUTER WHEEL  O6/08/2016  REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  O6/14/2016  PRESSURE WASH AND SANDBLAST  O6/15/2016  SAND BLAST BOX, PRESSURE WASH SAND  O6/16/2016  O6/18/2016  AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  O6/20/2016  PAINT FRAME, ENAMEL, SPRAY GUN  O6/21/2016  INSTALL LEFT LOWER MIRROR & BRACKET	02/16/2016	CHANGE OIL			
LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP  O6/06/2016 GREASE, ASSEMBLE NEW INTAKE ELBOW TO INTAKE, CHANGE THE LEFT REAR WHEEL WITH ONE OF THE REDONE WHEELS WORK ON REPAIRING EXHAUST  O6/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  O5/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  O5/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  O6/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  O6/09/2016 REPLACE RT OUTER WHEEL  O6/08/2016 REPLACE RT OUTER WHEEL  O6/14/2016 PRESSURE WASH AND SANDBLAST  O6/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  O6/15/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  O6/20/2010 PAINT FRAME, ENAMEL, SPRAY GUN  INSTALL LEFT LOWER MIRROR & BRACKET	04/18/2016	SPINNER MOTOR, SEAL KIT			
WORK ON REPAIRING EXHAUST  06/01/2016 ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  06/09/2016 REPLACE RT OUTER WHEEL  06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/07/2016	LIGHTS, LIGHT BAR UNDER BACK ON BOX, REPLACE DRIVER STEER WHEEL SEAL & BOTH STEER WHEELS, GET TAILGATE LATCHES FREED UP			
RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY  05/31/2016 ANNUAL - REMOVE TOOK BOX & MAKE NEW FLOOR FOR IT, REMOVE LID & SEAL & GLUE SEAL BACK ON, INSTALL THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  06/09/2016 REPLACE RT OUTER WHEEL  06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/06/2016	WORK ON REPAIRING EXHAUST			
THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL  05/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  06/09/2016 REPLACE RT OUTER WHEEL  06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  105/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/01/2016	ANNUAL - CONTINUE TO REPLACE BOX CONTROL CABLE, CHIP RUST & PAINT BEHIND TOOL BOX & THE CABLE CONTROL BOX, RIVET COVER BACK ON TOOL BOX AND GET IT HALF BOLTED ON BECAUSE THE SCRAPER IS IN THE WAY			
D5/26/2016 REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER HEATS, LOCATE AIR PRESSURE LEAK AND ORDER PARTS, THERMOSTAT, BEGIN ANNUAL  D6/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  D6/09/2016 REPLACE RT OUTER WHEEL  D6/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  D6/14/2016 PRESSURE WASH AND SANDBLAST  D6/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  D6/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  D6/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  D6/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	05/31/2016	THERMOSTAT & COOLANT, WORK ON REPLACING CABLE TO BOX CONTROL			
06/13/2016 REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL & REASSEMBLE THE CONTROL TOWER, LOCATE AND REPAIR AIR LEAK AT THE AIR DRYER  06/09/2016 REPLACE RT OUTER WHEEL  06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	05/26/2016	REPAIR AIR LEAK AT SEAT SUPPLY HOSE, TEST DRIVE, COULD NOT DUPLICATE, HAS CHARGE AIR PRESSURE LEAK & OVER			
06/08/2016 REMOVE RADIO, REPAIR EXHAUST LEAK AT TURBO, CHECK WIPER OP - WORKS ON HI - NEED WIPER MOTOR, ALSO NEED TO FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/13/2016	REPLACE FAULTY WINDSHIELD WIPER MOTOR, INSTALL NEW RUBBER BOOT OVER THE UNDERBODY CONTROL &			
FIND AIR LEAK  06/14/2016 PRESSURE WASH AND SANDBLAST  06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND  06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT  06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN  06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/09/2016	REPLACE RT OUTER WHEEL			
06/15/2016 SAND BLAST BOX, PRESSURE WASH SAND 06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT 06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/08/2016				
06/16/2016 AIR BLOW SAND, RUST INHIBITOR, SCRAP PAINT 06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/14/2016	PRESSURE WASH AND SANDBLAST			
06/20/2016 PAINT FRAME, ENAMEL, SPRAY GUN 06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET	06/15/2016	SAND BLAST BOX, PRESSURE WASH SAND			
06/21/2016 INSTALL LEFT LOWER MIRROR & BRACKET					
07/05/2016 SECOND ROUND DETAILING - WING, BOX	06/21/2016				
	07/05/2016	SECOND ROUND DETAILING - WING, BOX			

# BARRON COUNTY HIGHWAY DEPARTMENT BID FORM

1<sup>st</sup> viewing time: Tuesday, August 23, 2016, from 1pm – 3pm. 2<sup>nd</sup> viewing time: Thursday, August 25, 2016, from 10am – Noon. All bids are due by Wednesday, August 31, 2016, at 10am.

Name:		
Address:		441.
City, State & Zip: _		
Telephone Number(	(s):	
_	Bid Price for Patrol Truck #67	·····
most advantageous	Highway Department reserves the to the County or to reject any or aive any informalities in bidding.	right to accept the bid all bids (including the
sales tax. I agree the purchase as is and a have been awarded 2016, unless special Highway Department have not been made	items are sold as is, and without want I have looked over the item(s) list the bid price listed. I also agree the will be paid for and picked up by I arrangements have been made to prior to that date. If, by Septembers and the item(s) have not been picked the item(s) have not been picked and the item(s) have not been picked.	sted above and agree to hat any bid(s) in which I Thursday, September 8, with the Barron County r 8, 2016, arrangements ked up, I agree to have
 Signature		te